



# **USER MANUAL**

# **DLF-Series** Digital Label Finishers

this product is certified:







**IMPORTANT:** Please keep the original packaging in case you need to return the material. If we receive the system in non-original packaging, the warranty will be void.



<u>IMPORTANT</u>: The latest version of the DLF Series software is available on our websites, **afinialabel.com** or **afinialabel.co.uk** 

# <u>INDEX</u>


System requirements	page 3
How to install outer discs	page 3
How to install the plotter	page 3
How to install the cutting plotter	page 4
How to install the core holder	page 6
How to load and operate with the lamination module	page 7
Load the media into the plotter	page 9
How to run the cut test and start a job	page 10
How load the matrix remover & slitter	page 12
How to load the matrix remover core holder	page 13
How to load the rewinder core holder and set the slitter module	page 13
How to add or remove blade holder	page 15
Metal guide alignment	page 15
DLF CUTTING MANAGER	page 16
Error Messages	page 28
Black-mark detection	page 28
Cutting file specifications	page 29
Black-mark position into the cutting file and printed artwork	page 29
Black-mark position in the media	page 30
How to cut blank labels	page 30
How to update software	page 31
How to restore plotter settings	page 31
How and when to reduce the plotter feeding speed	page 33
Media path	page 34
Lamination / matrix remover&slitter modules speed rotation	page 35
How to install pressing roller	page 36
How to used the o-ring on the matrix roller	page 36
Graphtech mantenaice	page 37
How to replace the knife	
How to replace the slitter blade	page 39
How to replace the cutting mat	
Troubleshooting	

## SYSTEM REQUIREMENTS


The cutting manager works on Windows OS from Windows 8.1. We do not guarantee its functionality on previous versions. Not compatible with macOS systems.

Cutting files: Adobe Illustrator, CorelDraw or Inkscape (PDF).

Diagram connectors behind the on-off panel.

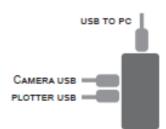



## HOW TO INSTALL OUTER DISC

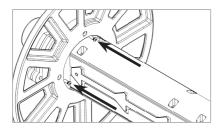

Using a screwdriver, install the outer disc on the Core Holder for printed rolls.


# HOW TO INSTALL THE PLOTTER

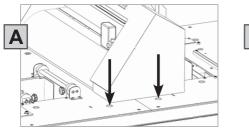

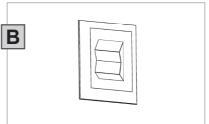

- A. Pull the plotter from the packaging and place it on the plate, make sure to push the rubber feet into the holes.
- B. Plug the machine and switch on.

# HOW TO INSTALL THE CUTTING PLOTTER

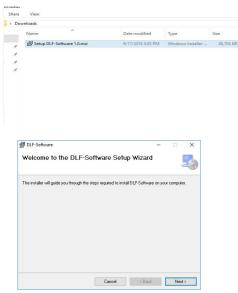

2. Click NEXT

ULF-Software	>
Select Installation Folder	-
The installer will install DLF-Software to the following folder.	
To install in this folder, click "Next". To install to a different fold	ler, enter it below or click "Browse".
Eolder:	
C:\Program Files (x86)\DLF-Software\	Browse
C:\Program Files (x86)\DLF-Software\	Browse Disk Cost
C:\Program Files (x86)\DLF-Software\	
C:\Program Files (x86)/DLF-Software\	
[C:\Plogram File: [68](DLF:Software)	
[C:\Program Fires (665)DLF-Software\	

4. Click NEXT



6. In process

1. Click on "Setup DLF-Software...msi" and follow the step by step instructions to complete the installation.

Please DO NOT connect the DLF USB to your PC before the installation is complete

	bio Cutting Manage	r Informatio	n			
500	no cutting Manager	i informatio			0	3
						_
UPGRA	VERSI	ON 1.8.6======				
UPGRA	-Advanced settings rotatio	n controls. You s	an now skow w			
	-Advanced settings rotatio					
UPGRA		011 2.0.0				
	-New media movements bu	uttons				
	VERSI	ON 1.8 2======				
UPGRA	DES:					
	-Added japanese language					
FIXES:						
	-Bug fixes and improvement					
	VERSI	ON 1.8.0======				
UPGRA						
	<ul> <li>Automatic recognition an decimal numbers</li> </ul>	d replacement of	the dot or the o	omm	a in the	
	-Interface more intuitive					

3. Click NEXT

DLF-Software is being installer	1	
Please wait		


5. Click NEXT



7. Click NEXT



8. Click FINISH

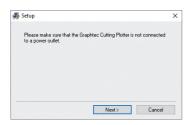

10. Click NEXT (*Remove the DLF USB* from your pc, and turn off the DLF)

Graphtec FC2250 Graphtec FC26000 Graphtec FC45000 Graphtec FC45000 Graphtec FC56000			A
Graphtec FC4500 SERIES Graphtec CE6000	Graphtec FC2250		
Graphtec CE6000 Graphtec FC8600	Graphtec FC4500	SERIES	
Graphtec FL8600	Graphtec CE6000		
	Graphtec FL8500		*

*12.* Choose the right model name of your Graphtec (CE7000-40).

Click NEXT

		×
htec Cutting Plotter driver ?		
0	K Cancel	_

9. Click OK

B Setup		×
Copying the driver files.		
Logo testing may appears o	ted by Graphtec Corporation a	
Please continue to proceed	I the installation.	
	Next >	Cancel

11. Click NEXT

99 199	Setup	,
	Update for the Graphtec CE6000 driver was completed. Please reboot your computer.	
	Do you want to restart your computer now ?	
	ОК	Cancel

*13.* Wait until the sign "Update for the Graphtec CE7000-40 driver was completed" shows up. You may need to restart the computer.

Click OK

Plug in the USB camera and the USB dongle, they will auto-install.

If your computer already has a camera installed, we recommend disabling it. If you do not, your pc will ignore the camera on the plotter.



DLF Software will generate a folder in the Windows start menu.

### SOFTWARE ACTIVATION


8			la la		×
		DONGLE	NOT FOUN	D	
	igain the dong	le			
Enter the XXXXX	- XXXXX	- xxxxx	- xxxxx	- xxxxx	- XXXXX
	OK			Cancel	]

To activate the software you must have these things:

- The unit's key, which can be found attached to the plotter and the software manual. *WHEN YOU ACTIVATE THE LICENSE YOU MUST BE CONNECTED TO INTERNET* 

#### *If you are updating software on an older DLF system, select the first options, Search for dongle.*

## HOW TO INSTALL THE CORE HOLDER

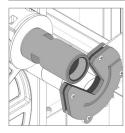




The grey handle must match with the grey holder and the black handle with the black holder.

**IMPORTANT:** screws must be face down.

# HOW TO LOAD AND OPERATE THE LAMINATION MODULE

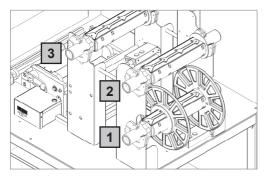


Core Holder No. 1 > Printed roll


Core Holder No. 2 > Liner roll

Core Holder No. 3 > Laminate roll

Load the printed roll and move it against the roll guide. Tighten the core holder.

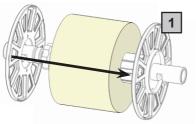



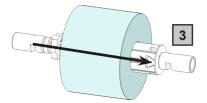

 Load an empty cardboard core onto the shaft intended for laminate liner rewinding. Tighten the core holder.


Load the lamination roll, move it along the supply shaft and make sure the lamination is aligned with the media roll.

**IMPORTANT:** the lamination roll always needs to be narrower than the web width. *Example: if the web width is 7" then the lamination roll needs to be lesser than 7" (let's say ¼ inch on each end).* At this point you can tighten the core holder.

When the LEDs on the control board are off, the device works on a manual feeding.


Move the media through the rollers, close the nip roller and press the FORWARD button. The media will be loaded through the rollers.

Switch on "*Auto*" button to active the automatic media feeding mood. The green led will be on.

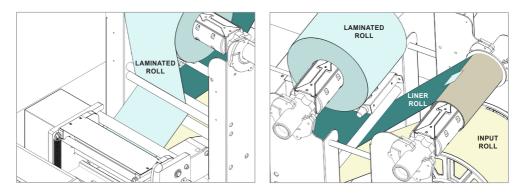

Hold the laminating film with both hands, pull it through the guide rollers, center it and adhere the laminating film to the web and attach the liner onto cardboard.

**!PLEASE LOOK AT THE LAMINATION PATH!** (PAGE 25)

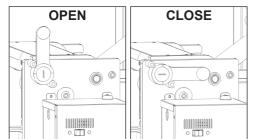

Using the black knob to open or close the nip roller.


This will apply pressure on the laminating film to adhere to the media avoiding any possible air bubbles.

When both yellow and green leds are flashing it means the system is in error status. The error occurs when the media roll, lamination roll or both are not loaded, broken or simply they are run out.

To clear the error it is just necessary to restart the module switching "*Manual*" then "*Auto*" button again.

#### **MEDIA TENSION CONTROL**

Each core holder (ON THE LAMINATING & UNWINDING MODULE) is managed by its own controller designed to set the required media tension, keeping that tension automatically constant even the roll diameter variation during the job.

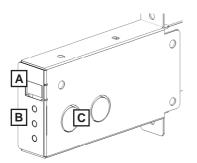

A) Display

B) ON/OFF : activate/deactivate the tension control

- +: increase the media tension
- : decrease the media tension


C) Ultrasonic sensor


#### Display conditions:

- flashing O - F - F = the controller is deactivate - flashing number = the controller is active and it shows the tension level set


Keeping "run" pressed; the core will spin

# LOAD THE MEDIA INTO THE PLOTTER

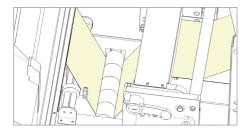

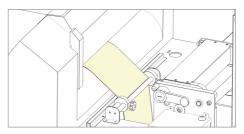


Pull the laminated media underneath the tension arm, than pass it through the aluminium rollers, the guide can be adjusted preventing the web from rolling.

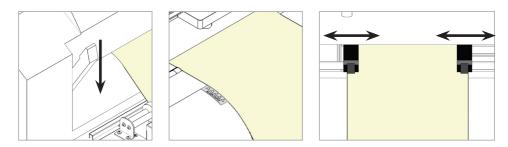

Put the lever, located in the rear of the plotter, in the down position.

Pull the media through the plotter and keep the media edge aligned to the alignment points.

Set both pinch rollers at the media edge.

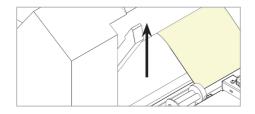



While holding down the media in the aligned position, lift the lever back to its up position. This will lock the media in place.

Press button 2 as requested on plotter's display.

### >> How to run the black-mark mode

User Interface at page 16 might be helpful.

1. Open DLF Cutting Manager.

2. Press "OPEN PDF" or "OPEN LAST JOB" to load the cutting file.

3. Look at the camera preview, hold down "BACKWARD MEDIA" or "FORWARD MEDIA" arrows to move the web until the black-mark goes in the center position of the blue rectangle area.



4. Measure the distance in (MM) between the top of one black-mark to top of the next black-mark, key in this value in the "DISTANCE BETWEEN BLACKMARKS" box section.



<u>IMPORTANT:</u> Working with DLF-220L or DLF-350L models, please open "*ADVANCED BUTTON*", click on Settings and uncheck Media/ Lamination Sensor option, then save and close the pop up.

5. Make sure the "Enable" in the blank mode is unflagged.


6. Press "CUT TEST" to check for cut depth. If the liner has been cut, decrease the cutter pressure value in the cut force box. If label doesn't detach, increase the cutter pressure value in the cut force box.

7. Make sure label is aligned with the cut. Through X and Y values, adjust offsets if cut doesn't match label.







move down the cutting file

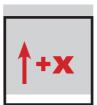

move up the cutting file

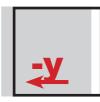

move t o the left the cutting file

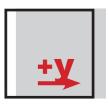

move t o the right the cutting file

Once the cut settings are properly set, select "COPY MODE" ON if you desire a preset quantity of copies or OFF if you desire unlimited copies until the media roll is finished.
 Set the black-mark size" in "BLACK-MARK MODE" area.

10. Press "START".



#### **IMPORTANT**:

Whenever you lower and rise the lever while you are in black-mark mode, hold down the forward media arrow button to move again the plotter's head down.

# >> <u>How to run the blank mode</u>

- 1. Press "OPEN PDF" or "OPEN LAST JOB" to load the cut file.
- 2. Set the copy mode **ON**, and set 2 as number of copies.
- 3. Click "START".
- 4. Check the horizontal position and the gap between the cuts.

5. If necessary, adjust the offset X and the distance between each cut in the "STEP" box.

6. Once the cut is set properly, select copy mode: ON if you desire a preset quantity of copies, or OFF to cut until the media roll is empty.


7. Working with *DLF-220L or DLF-350L* models, please open Advanced button, click on Settings and uncheck Media/Lamination Sensor option, then save and close the pop up. 8. Click "START".

#### **IMPORTANT:**




Working with DLF-220L or DLF-350L models, please open "*ADVANCED BUTTON*", click on Settings and uncheck Media/ Lamination Sensor option, then save and close the pop up.


# HOW LOAD THE MATRIX REMOVER & SLITTER

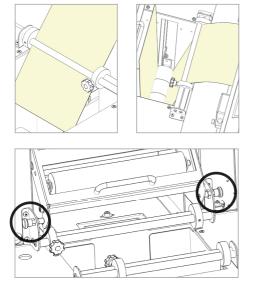

After you CUT TEST is successful, press "START" to cut a few labels until you think you have enough media to load onto the matrix remover.

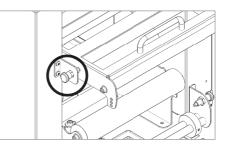


Pull the sides of the black knobs and lift up the clutch system, other black knobs will keep it open.

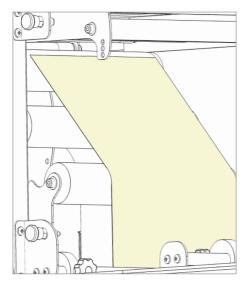

Pull the media through the aluminium rollers first (the guide can be adjusted in order to prevent the web from rolling) then through the clutch system.

Close the loading system and the media will be automatically loaded into the clutch path.

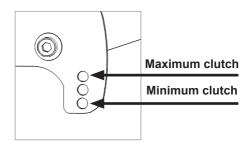

The user can adjust the clutch force thanks to the position of the clutch system.

Maximum Clutch (rewinded roll more tight) Minimum Clutch (rewinded roll less tight)

# HOW TO LOAD THE MATRIX REMOVER CORE HOLDER




<u>WARNING</u>: Before starting a job, always remove the waste media from the matrix remover core.

Tape the matrix securely onto the cardboard core.

System operating issues may occur if the above suggestions are not followed.



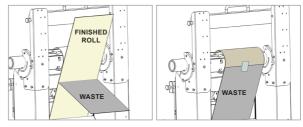


1. Load empty cardboard core(s) and tighten the core holder, then place the motorized core holder in position.

2. Peel back the matrix.

3. Pull the matrix and attach it to the matrix remover core holder.


# HOW TO LOAD THE REWINDER CORE HOLDER AND SET THE SLITTER MODULE

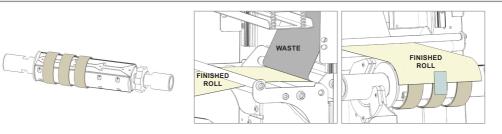

1. Load empty cardboard core(s) and tighten the core holder, then place the motorized core holder in position.

(Cardboard core(s) width should equal (or narrower) the width of the finished roll). 2. Pull the media through the aluminium rollers and attach the labels to the core using a waste label.

#### **!PLEASE LOOK AT THE LAMINATION PATH!** (PAGE 25)

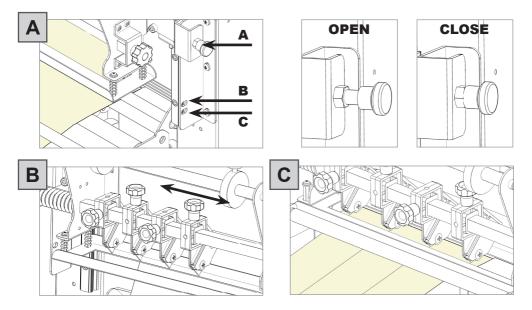


#### Slitter module has 3 positions:

- Upper position (A), the blades are lifted to allow the media loading;

- Middle position (B), align the blades with the edges and the center of the labels, tighten the thumb screw once the blade is in position;


- Lower position (C), the blade cut the media.

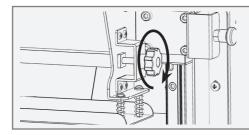

The black knobs lock the slitter module in the requested position. Screw the thumb knobs to move the blades to the right or to the left.



3. Turn ON the Matrix Remover module to rewind and start to split the media, than turn OFF.

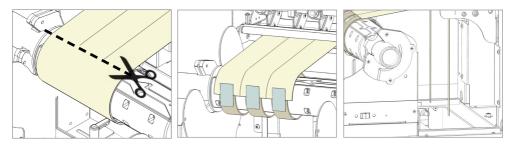


4. Cut the labels when the first "good" labels are visible;

5. Make sure the tension on all rolls is even and attach each label to the core using a waste label;


6. Feed edges trim waste into the waste basket under the hole.

#### Press RESUME to start your finishing process.

# HOW TO ADD OR REMOVE A BLADE HOLDER

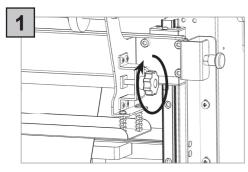


Remove the iron bar by unscrewing the black thumb screw.

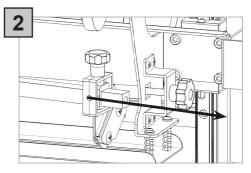


Slide in or out the blade holder. Relocate the slide iron bar in its position and rescrew the thumb screw.

#### METAL GUIDE ALIGNMENT

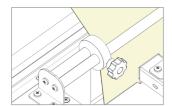




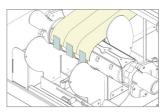

Metal guides can be adjusted in order to prevent the web from rolling.

# Afinia cutting manager (Afinia CM)

## **USER INTERFACE**

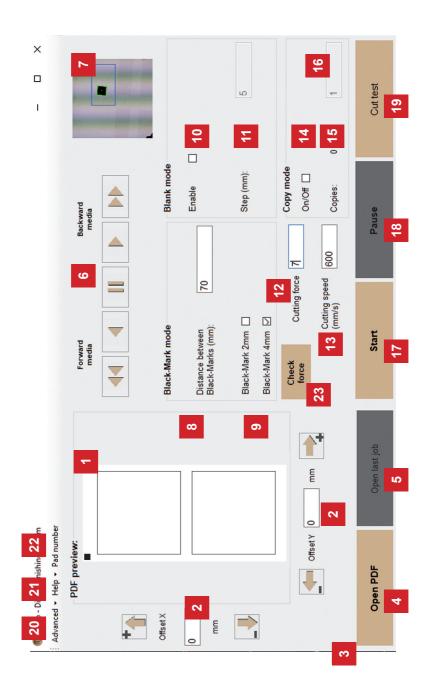

- 1. Cutting file preview.
- 2. Alignment adjustement controls.





MOVE DOWN

THE CUTTING FILE



-Y



MOVE TO THE RIGHT THE CUTTING FILE

- 3. Status bar.
- 4. Selects the cutting file.
- 5. Open the last cutting file.
- 6. Controls to move the media forward or backward.
- 7. Camera preview .
- 8. To set the distance between the base of each black-mark.
- 9. To set the size of the black-marks.
- 10. Enable or disable blank mode.
- 11. To set the distance between each label.

#### Any extra border on the bottom of your cutting file is added to the step.

**12.** To set the Graphtec's blade strength and increase the cutting depth. Its value can be from 1 to 31. The most common values in label cutting are from 7 to 9.

**13.** To set the cutting speed. Its value can be from 50 to 600. The most common value in label cutting is 600. If you have a cutting force major than 9, you may need to decrease the cutting speed to have a proper precision.

**14.** Flag to determined number of copies to cut during a cutting job launched with the "Start" button, otherwise the plotter will continue and stop at the end of the media.

15. Counts the number of copies cut since pressing the "Start" button.

16. Section where to put the number of copies needed to be cut.

17. Start/Cancel button. Used to launch or stop a cutting job.

18. Pause/Resume button. Used to pause or resume the cutting job.

19. Used to launch a single cut to let the user check the cutting parameters.

#### 20. Advanced controls.

21. Help: here you can find a path to open the user manual, and useful video guides.


22. Pad number: screen pad number useful for touch screen.

**23.** Check force: If you click this button the plotter will make 5 squares each one with a different cut force. A number inside the square will show how much the force is increased or decreased. This is useful to find quickly the most proper force value for your material. however we suggest to start with little values, in order to don't damage accidentally the cutting mat with the high force squares.

MOVE UP THE CUTTING FILE

MOVE TO THE LEFT THE CUTTING FILE

# **ADVANCED OPTIONS**

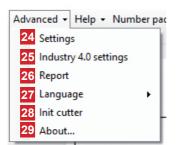

- 24. Settings
- 25. Settings for the industry 4.0
- 26. List of cut logs
- 27. Set interface's language
- 28. Restore of the plotter's settings
- 29. Additional information

Saved offsets		Tools 4	Ch	eck area	2	-
Delta X (mm):	-3		Vormal ~ x (	px): 0		+
Delta Y (mm):	-10.2	Cut sorting 5				
Dashed lines		Vertical start point	у (	px): 0		
Cut length (mm):	1	Enable distortion fixer	6			
Space length (mm):	1	Correction X (mm): 0				
Black-Mark tolerance	S	Correction Y (mm):	wi	idth (px):	250	
4x4mm		Enable overcut	7			
Minimum area (px):	2900	Start length (mm): 0	.7 He	eight (px):	150	
Maximum area (px):	4100	End length (mm):	Se	nsors 3		
2x2mm				Media/Lamina	tion sensors	
Minimum area (px):	484	Rotation (deg°): 0	.0			
Maximum area (px):	1156	13		Check inline p	rinter	
Save	Cancel			Reset	SAVE NEW	DEFAULT SET

**1.** When you launch a cut with new offsets, they will be added to the deltas. The deltas store the saved offsets.

**2.** All the 100% magenta lines in your cutting file will be recognized as dashed. Here you can set the cut length and the spacing between each on of them. They must be at least 0.1mm, and not more than 819mm.


**3.** Here you can choose to enable or disable the media or lamination sensors. If "Media/ Lamination sensors" is checked, when the material ends, the software stops the cut and will give you an alert.

# Settings (24)

4. Approximation of the cut curves.


**5.** If cut sorting is enabled, the software will automatically select the order of the cut of all the shapes on the file. Otherwise, the cut will follow the .pdf layers order.

**6.** When you print your rolls, sometimes you may have distortion on your output. In that case, even with a correct set of the offsets, the cut may not match your print. You will have to enable the distortion fixer, and set the corrections. A positive value will stretch the cut on that axis, otherwise with a negative one, the cut will be more compressed.

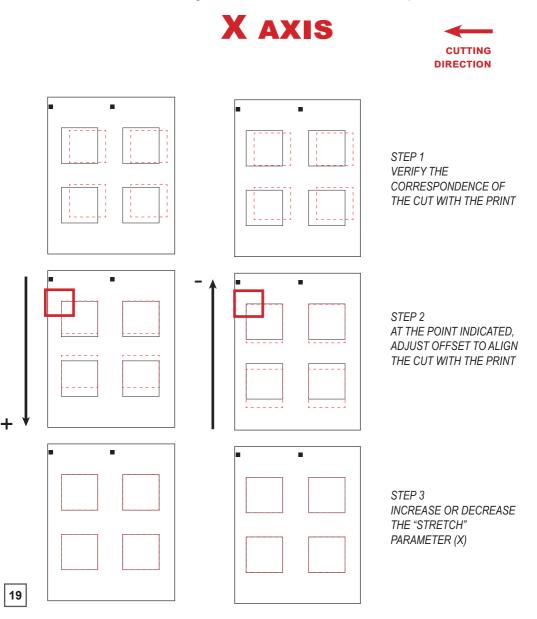





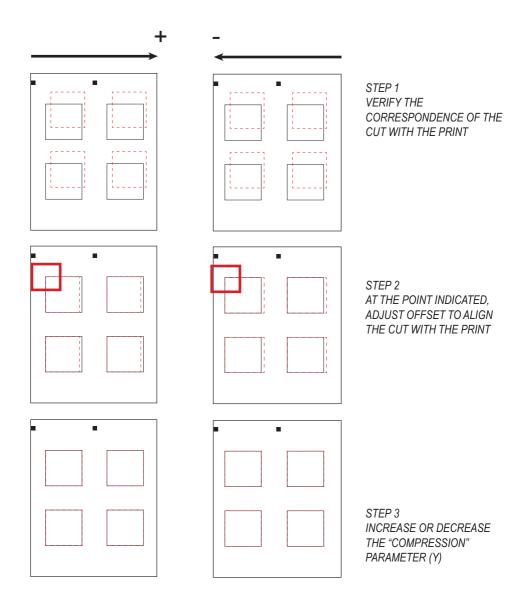

**7.** With thin materials the cut may not be closed. To fix this, enable the overcut, and set how much you want the blade to start early, or end later. You can anticipate or delay the end of the cut up to 0.9mm for each one.

**8.** Check area parameters lets you change the position of the Black-Mark's checking area, which is the blue square shown in the camera preview while the blank mode is disabled.

**9.** In case your print has distorted the output of your blackmark, you can change the tolerances to let the cam recognize it. The tolerances must be positive values.

If your blackmark side is smaller than 4mm (for 4x4mm) or 2mm (for 2x2mm), you will have to reduce the minimum area by 100, until the blackmark is recognized. If your blackmark side is higher than 4mm (for 4x4mm) or 2mm (for 2x2mm), you will have to increase the maximum area by 100, until the blackmark is recognized.

10. Click to restore the default settings.


11. Discard the changes and closes the window.

12. Save the changes and closes the window.

#### 13. Your artwork may be not printed straight.


When this happens, the cutting lines will have a different grade from your artwork. To fix this you can rotate your cut.

The arrow near the textbox shows you towards which direction will be rotated your cut. *Usually the artwork should not be too much rotated*. When you check the cutting rotation we suggest you to change by 0.1 degrees with the arrows your value, and then proceed with a cut test.

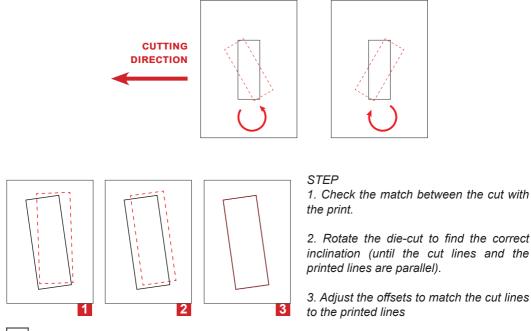

**14.** This button allows you to set the current values in your interface as the new preset for any time you will load a new file.

When you click it one window will appear. Through it you can choose to update the main interface preset, the settings preset or both of them

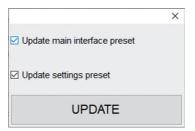

15. This button determines wheter the cut starts in the middle of a vertical side, or not.

#### Industry 4.0 settings (25)

Ð		×
Enable	server 🗹	
IP:	auto	
Port:	3333	
S	ave	Cancel

Here are all the settings necessary for the industry 4.0 communication (TCP/IP).

Once you enable the server, the machine will start to be available on the network.

After that you can set the IP (if set to "auto" it will automatically be the same of the last network ethernet adapter) and the port.

#### Report (26)

Report			-	×
Save as File name -wine label-cutfile.pdf	CutTests 0	Copies 3	Time elapsed 6s	ŕ

Report will display the cuts run by the Cutting Manager system.

Each session report is automatically added and saved into the history report when cutting manager is closed.

You can find the complete report history file of all the jobs run since cutting manger has been installed to this path "*C:/Afinia Cutting manager/Report/CutHistory.txt*".

Clicking on "SAVE AS" will save which ever work session report you choose to save.


Cutting parameters are saved after every completed job. So the next time you will re-open the software, you will have automatically added to the interface the settings you have used with the file selected (force, speed, cutting mode,...)

- 1. Go to Panel control.
- 2. Unistall Afinia Cutting Manager.
- 3. Download from the website the new Cutting Manager release and run the installation.

## **DEVICE SELECTOR**

Whenever you plug two units (YOU CANNOT USE MORE AT THE SAME TIME) to the pc, the device selector window will show up, and it will allow you to select which machine run.

WHILE WORKING WITH TWO UNITS AT THE SAME TIME, PLEASE USE A USB 3.0 HUB (ALSO PLUGGED TO A USB 3.0 PORT)

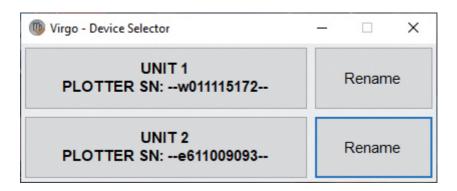

# **INDUSTRY 4.0**

## **COMMUNICATION SPECIFICATIONS**

The user application must communicate with the Afinia server by using tcp/ip. By default the server ip is the same of the network plugged to the ethernet port, and the server port is the 3333.

You can't send to the server more than 65MB of data.

The (), +, "", and ... characters in this documentation are used just to simplify the understanding, and they are not part of the commands.

Each command sent or received ends with "!", used as terminator. If you send unrecognized command, the server will return "Unknown command sent!"

#### **OBTAIN DLF STATUS**

Command: GET\_STATUS!

**Description:** With this command you get the status of the DLF and its jobs. Each block of data containing DLF status or job data, ends with a 0x17 hexadecimal character.

#### Return data:

(DLF STATUS) DLF STATUS: not cutting/cutting/paused + 0x17 (end of DLF status data) +

(JOB1) N:(job code),STJ:(job status),FD:(number of files c ompleted),FTD:(number of files to do),C:(customer),TS:(job start time) + ; (end of JOB1 data) +

(FILE\_A OF JOB1) F:(file name),ST:(file st atus "n ot cutting/cutting/paused/suspended/completed"),M:(m aterial),CT:(cut tests done),LD:(layouts done),LTD:(layouts to do),TL:(total of labels done),TE:(time elapsed in seconds),MS:(material speed "x m/min/start and stop/ sheets"),FS:(file start at) + ; (end of FILE\_A data) +

(FILE\_B OF JOB1) F:(file name),... + ; (end of FILE\_B data) + 0x17 (end of JOB1 block of data) +

(JOB2) N:(job code),... + ; (end of JOB2 data) +

(FILE\_C OF JOB2) F:(file name),... + ; (end of FILE\_C data) + 0x17 (end of JOB2 block of data) + ! (terminator) Example of returned data (line feed and carriage return are shown here, and they are not actually returned):

(if after the commands code there isn't any data, it means that this value is not set yet. For example if after TS: there isn't anything, it means that the job is not started yet)

#### DLF STATUS:cutting(0x17)

N:001,STJ:cutting,FD:0,FTD:2,C:Customer 1,TS:dd-mm-aaaa H:mm; F:file1,ST:cutting,M:paper label,CT:3,LD:100,LTD:2000,TL:300,TE:3500,MS:16 m/min,FS:dd-mm-aaaa H:mm; F:file2,ST:not cutting,M:paper label,CT:0,LD:0,LTD:3000,TL:0,TE:,MS:,FS:;(0x17) N:002,STJ:not cutting,FD:0,FTD:1,C:Customer 2,TS:; F:file3,ST:not cutting,M:plastic label,CT:0,LD:0,LTD:2000,TL:0,TE:,MS:,FS:;(0x17)!

#### JOB ENDED NOTIFICATION

#### Description:

Every time a job ends (so whenever the layouts to do for each file are completed) the server will remove it from the queue, and provide to each connected user a report. *The Afinia software also stores a report of any completed job in C:DLF Cutting Manager*\*Report*\*Queue jobs completed report.txt* 

#### Return data:

(JOB1)

N:(job code),STJ:(job status),FD:(number of files completed),FTD:(number of files to do),C:(customer),TS:(job start time) + ,TF:(job end time) + ; (end of JOB1 data) +

#### (FILE\_A OF JOB1)

F:(file name),ST:(file status "not cutting/cutting/paused/suspended"),M:(material),CT:(c ut tests done),LD:(layouts done),LTD:(layouts to do),TL:(total of labels done),TE:(time elapsed in seconds),MS:(material speed "x m/min/start and stop/sheets"),FS:(file start at) + ; (end of FILE\_A data) +

(FILE\_B OF JOB1) F:(file name),... + ; (end of FILE\_B data) + ! (terminator)

# Example of returned data (line feed and carriage return are shown here, and they are not actually returned):

N:001,STJ:completed,FD:2,FTD:2,C:Customer 1,TS:dd-mm-aaaa H:mm,TF:dd-mm-aaaa H:mm; F:file1,ST:completed,M:paper label,CT:2,LD:1000,LTD:1000,TL:3000,TE:2000,MS:16 m/min,FS:dd-mm-aaaa H:mm; F:file2,ST:completed,M:paper label,CT:2,LD:2000,LTD:2000,TL:8000,TE:3000,MS:start and stop,FS:dd-mm-aaaa H:mm;

# APPEND JOB TO QUEUE:

#### Command:

APPEND:N:(job code),C:(customer);(FILE\_A->)F:(file name),M:(material),LTD:(layouts to do (number or "u" for unlimited));(FILE\_B->)F:(file name),...;!.

#### Description:

This command allows you to append a new job to the queue. YOU MUSTN'T USE FILES WITH THE SAME NAME AMONG THE JOBS. FOR EXAMPLE YOU CAN'T ADD FILE\_A TO BOTH JOBS N:001 AND N:002, OR ADD IT TWO TIMES TO THE SAME JOB.

#### Example of sent data:

APPEND:N:001,C:Customer 1;F:FILE\_A,M:paper label,LTD:300;F:FILE\_B,M:plastic label,LTD:200;!

#### Return data:

If the command syntax is correct it returns "Job appended to queue with success!". Otherwise it returns "The APPEND request syntax is not correct, it should be "APPEND:N:job\_code,C:customer;F:file\_1,M:material,LTD:layouts\_to\_do;F:file\_2,M: material,LTD:layouts\_to\_do;...(terminator)!"

## **REMOVE JOB FROM QUEUE:**

**Command:** REMOVE:N:(job code/all);F:(file name 1,file name 2/all)!

#### **Description:**

This commands allows you to remove jobs or files from the queue.

#### Example of sent data:

(REMOVE ALL JOBS) (REMOVE ALL FILES OF A JOB) (REMOVE SPECIFIED FILES) REMOVE:N:all! REMOVE:N:001;F:all! REMOVE:N:001;F:FILE\_A,FILE\_B!

#### Return data:

If the command syntax is correct it returns "Files removed with success!". Otherwise it returns "Remove didn't go properly:(list of errors)!".

# JOBS QUEUE WINDOW

1							×
Job code	Customer	Order	File	Material	Layouts done	Layouts to do	
001	Customer 1	1	wine label-cutfile-9CM	paper	0	5	Ŵ
		2	DIECUT215	paper	0	6	Ŵ

#### **Description:**

Each time a job is appended to the queue, it gets shown in this window.

The user can see for each job which files needs to open, their order, the type of material, the layouts to do.

The user can even choose to delete the files from queue, by clicking on the trash can icon on the right.

Whenever a job gets completed the layouts to do for each file, the job will be considered ended and removed from the window.

# ERROR MESSAGGES

If the plotter is not connected correctly to the computer, the following errors will be displayed at the application launch:

	×
Error: plotter not found	
Retry Cancel	
8	
	×
Error: load the media	
	_

Make sure the plotter is switched on and properly connected. In case it is turned off, please turn the plotter on and than press the button 2 on control panel and wait until the display will show "READY" as status. Then press retry on the popup window.

Ensure the media is loaded properly. Raise the lever on the plotter, then press the number 2 on control panel. wait until the display will show "READY" as the status. Then press retry on the popup window.

## **BLACK-MARK DETECTION**

To prevent any issues, it is important that the camera is reading the black-mark properly.

Look at the camera preview, hold down "BACKWARD MEDIA" or "FORWARD MEDIA" arrows to move the web until the black-mark goes in the center position of the blue rectangle area.

Forward media	Backward media		Forward E media	Backward media	
W	rong pos	sition	corr	rect	position

# **CUTTING FILE SPECIFICATIONS**


#### Cut Files: Adobe Illustrator and/or Corel Draw (save as PDF file).

The artwork ile within the cutting shape must include a registration square black mark having a size of 4x4mm (0.16"x0.16") or 2x2mm (0.08"x0.08").

# Only the cut lines and black mark (not needed for the blank labels) can be in the saved cut file.

Graphics layers must be deleted or the cut line shapes must be copied in a new file and saved instead of hiding or disabling any extra content.



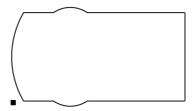

The cutting shape must be 100% black (otherwise in case of dashed lines, it must be a 100% magenta normal line) and have a thickness of 1 pt.


# The black-mark MUST ALWAYS be the object placed in the lower left corner of any layout file.

The DLF Cutting Manager (DLF CM) work with the VECTOR PDF FILE. You can create this file with Adobe Illustrator or Corel Draw.

#### **MOST IMPORTANT:**


To guarantee the black marks size and its position printed correctly on the media, the artwork must be printed with the actual size, make sure to avoid any fit or scale

#### **BLACK-MARK POSITION INTO THE CUTTING FILE AND PRINTED ARTWORK**

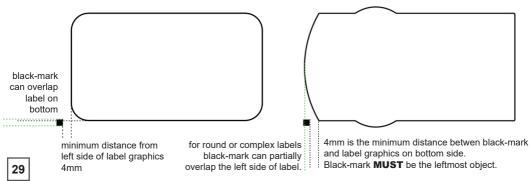

Black-mark size: 4mm x 4mm (0.16" x 0.16") or 2mm x 2mm (0.08" x 0.08")

# **BLACK-MARK POSITION IN THE MEDIA**

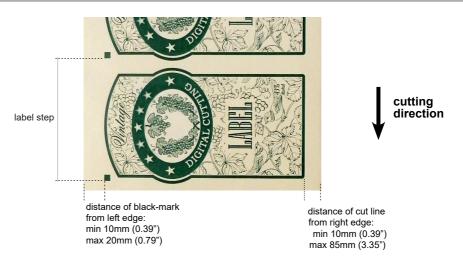


# HOW TO CUT BLANK LABELS



If you wish to use the "blank label" feature to cut blank labels (without registration mark), please follow these steps:

1. Import the cut file (without registration mark) into the software.

2. Select the "blank label" feature from the software and enter the number of copies that you wish to cut.

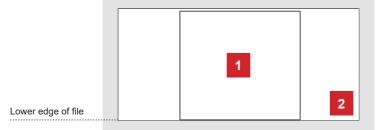

3. Click "Start".

1. Diecut shape 2. Size of File

The diecut shape must be attached to the bottom edge of the file. The distance you leave will automatically be added to the gap that you will enter in the "STEP" item.



WARNING: Please note that enabling the blank label feature will disable both cut test and Y offset adjustment.

30

# HOW TO UPDATE SOFTWARE

- 1. Go to Panel control.
- 2. Unistall DLF Cutting Manager.
- 3. Download from the website the new Cutting Manager release and run the installation.

# HOW TO RESTORE PLOTTER SETTINGS

- 1. Turn off the plotter.
- 2. Turn on the plotter while keeping pushed the UP arrow on the panel.



# LENGTH UNIT



9. Select metric by pressing button 1 and then enter.



*11.* Wait until on the display appears "READY".



13. Go to Command (press 2).



15. Press "PAUSE/MENU".

SELECT 1 ROLL-1 FRONT EDGE 2 ROLL-2 CURRENT POSITION 3 SHEET

10. Press button 2.



12. Press "PAUSE/MENU" then go to I/F (press up arrow key).



14. Select GPGL (press 1 then enter).



16. Restart plotter then press button 2.



*17.* Wait until on the display appears "READY".



*19.* Wait until "Init cutter completed" will be shown in the status bar.

Plotter display will show "LABEL MEDIA" as status.

Advanced -		
Settings		
Report		
Language		
Init cutter		
About		

Scornio - Digital Finishing System


*18.* Open the Cutting manager and click on "Advanced" and then select "Init cutter". Click "YES" to confirm

## WHEN AND HOW TO REDUCE THE PLOTTER FEEDING SPEED


When cutting label longer than 250mm - 10", is recommend to decrease the cutting speed. The cutting speed reduction depends on the job in process.

The cutting speed can be set within the range of 50 to 600.

# LAMINATION MODULE

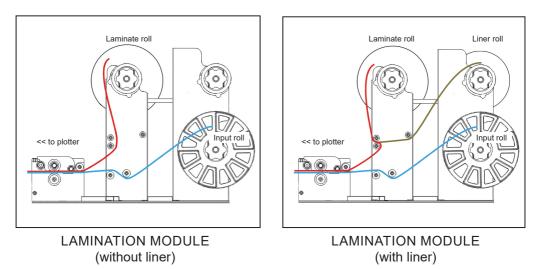

# **MATRIX REMOVER & SLITTER MODULE**

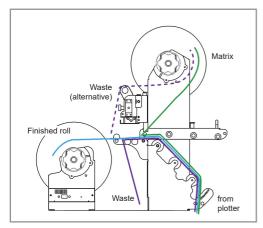


MATRIX REMOVER AND SLITTER MODULE CAUTION:


Both cardboard cores loaded must be with the same external diameter.

# LAMINATION MODULE

ULTRASONIC TENSION CONTROLLER

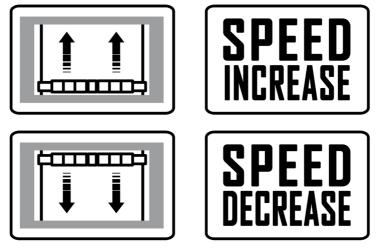

# **MATRIX REMOVER & SLITTER MODULE**

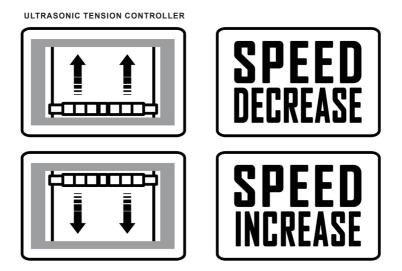


# HOW TO INSTALL PRESSING ROLLER




The pressing roller facilitates the matrix removal from the die-cut roll.

How to install the roller:

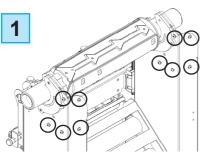


Unscrew the 10 screws on the matrix remover module.

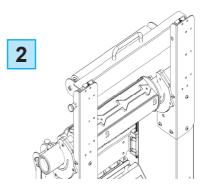

Position the matrix remover roller onto the matrix remover module and secure it properly with the 10 screws.

# HOW TO USED THE O-RING ON THE MATRIX ROLLER

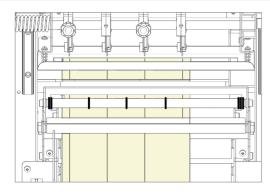


The o-rings of the matrix remover roller are used to facilitate the removal of your matrix from the labels.

Place one or more o-rings (depends on the width of the label) at the center of the die-cut label.

Then proceeds with the normal loading of the media. (page 12)

## Cutter Plunger

The plotter cuts using a cutter blade mounted in a plunger. There are two different plungers to suit the diameter of the cutter blade to be mounted (the 0.9 mm cutter plunger is provided as a standard accessory). Be sure to mount the cutter blade in the corresponding cutter plunger.

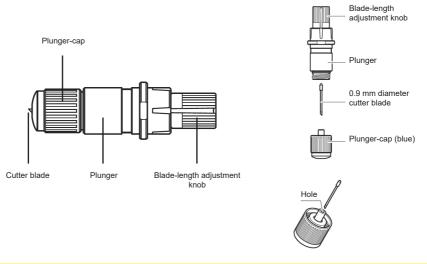

CAUTION: To avoid bodily injury, handle cutter blades with care.




<u>WARNING</u>: It may result in damaging the cutter blade or the cutting mat if the blade is extended too much. Make sure the blade length is set less than the thickness of the media.

Adjust the blade length by turning the blade-length adjustment knob. Turn the knob in direction "A" to extend the blade, or in direction "B" to retract the blade. When the knob is turned by one scale unit, the blade moves approximately 0.1 mm. One full turn of the knob moves the blade approximately 0.5 mm.


Cutter blade moves approximately 0.1 mm turning one scale unit



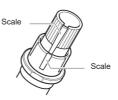


## Mounting the tool


1. Loosen the tool holder screw.

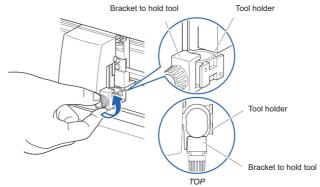

2. While pushing up the tool holder, push until its flange completely touches the upper part of the holder.

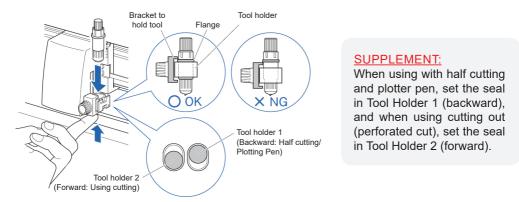

3. Make sure that the tool bracket is engaged on the tool's flange, and then tighten the screw.

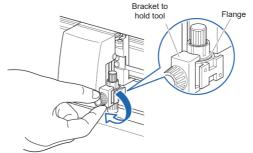


### Removing the tool

When removing the tool, turn it counterclockwise to remove the tool.

# HOW TO REPLACE THE KNIFE

See page 25 for the structure of the cutter plunger.

1. Turn the blade-length adjustment knob in the direction of the B arrow and pull the blade into the plunger.

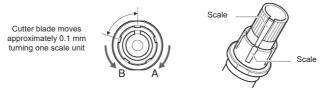

2. Turn the plunger cap in the counter-clockwise direction to remove it from the plunger.

3. Remove the blade from inside the plunger cap.

4. Remove a new blade from its pack. Insert the new blade into the hole provided in the plunger cap.


5. With the blade inserted into the plunger cap, screw on the plunger from above.

6. Fix the plunger cap by turning it clockwise.



<u>ATTENTION:</u> In order to preserve the lifespan of the plotter knife and not to wear it out quickly, it is best to properly calibrate the knife exposure and cut force depending on the media thickness.

## HOW TO REPLACE THE SLITTER BLADE

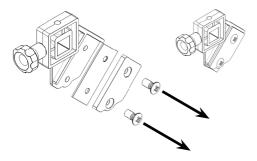

Loosen the two screws holding the blade in place.

Replace the blade.

Fix back the screw to holding the blade in place.

# HOW TO REPLACE THE CUTTING MAT




#### **CAUTION:**

Please turn off the power when replacing the cutting mat. Please move the tool carriage to "A" position allowing for ease of work.

### 1. Remove the cutting mat.

-The cutting mat is attached to the cutting base (fig.2)


-Please remove only the cutting mat from the cutting mat base from the location shown by the arrow (A) (fig.1)

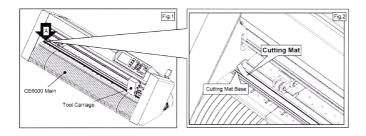

- After removing the cutting mat, please make sure that there is no adhesive tape or other adhesives left on the cutting base.
- Please clean the cutting mat base before installing the cutting mat.
- Installing the cutting mat with the remaining adhesive may affect cut quality.

### 2. Installing the cutting mat.

- Fit the cutting mat with the front cutting base grooves (fig.3) and attach it from the location shown by the arrow (A) (fig.1) while peeling off the release paper.

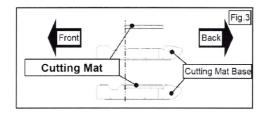

## IF YOU ARE EXPERIENCING THE FOLLOWING ISSUES WITH THE ANY OF OUR DLF UNITS, PLEASE FOLLOW TROUBLESHOOTING STEPS BELOW

### <u>Yellow and Green LED's simultaneously on lamination control board</u> (Applies to all DLF models)

**Problem:** Yellow and Green LED's simultaneously on lamination control board. This will also create the following error:



**Cause:** All DLF Digital Finishing Systems are equipped with two reflective sensors on the lamination module. One is the media sensor, located right after the first two guide rollers, and the other is the lamination sensor, mounted between the two black knobs on the rubber roller assembly. When both the yellow and green LED's on lamination control panel are on, it would indicate that either one or both of the sensors have picked up an error and the cause could be due to either the media or lamination roll has run out or the sensors may be out of sync and needs to be re-calibrated. The following steps below will show you how to tell when each sensor is in error mode and how to correct it or help you re-calibrate each sensor if needed.

### Media not aligned properly

**Problem:** If the media is not aligned properly after running a couple of jobs.

**Cause:** This problem occurs for a couple of reasons. The primary reason would be that the tension force on the on the rubber roller assembly, media core and the lamination core (If using lamination) are all out of sync and needs adjusting. Another reason could be that the media was wounded unevenly to begin with thus creating an uneven media roll. Make sure the distance between top to top black-marks is set correctly.

**Fix:** First check to see if you have a flat even media roll before you begin installation. An uneven media roll will cause the job to misalign itself. If that checks out ok, then you will need to adjust the tension force on the lamination module. To do this you must turn the two black knobs located at the top the rubber roller assembly to adjust the tension force until you receive satisfactory results. If needed, this may have to be done in conjunction with adjusting the clutch tension on both the lamination core (*If using lamination*) and the material core using the aluminum handles. Adjust the tension force at all three locations accordingly until you get the perfect setting and the media is properly aligned.

### Plotter error "E01017 Hardware X Position Alarm Power off then on



**Problem:** The plotter displays an error *"E01017 Hardware X Position Alarm Power off then on".* 

**Cause:** The plotter will give you this error after starting a job in *DLF CM* and the tensioner arm was not set-up to begin with or the tensioner arm was positioned too high after turning on the lamination module.

# (\*\*NOTE\*\* To set the tensioner arm properly, the arm must always be at a midpoint position or lower before turning on the lamination module).

#### Fix:

- 1. To set-up the tensioner arm, first turn off lamination module. (\*\*NOTE\*\* The lamination module must be off for the next steps to work.)
- 2. Use the arrow buttons at the top of the control panel to manually feed the media forward until the arm descends into the correct position (\*\*Correct position for the tensioner arm will be midpoint or lower).
- 3. Once Tensioner is in the correct position, turn ON lamination module.

# (If done successfully, the tensioner arm will automatically re-adjust itself thus activating the unwinder motor).

4. Restart Cutting Manager software

### Plotter is not cutting or Plotter cutting all the way through the material

**Problem:** After starting a job, you notice that the plotter is not producing a clean cut through the media or the plotter is cutting all the way through the media.

**Cause:** This happens if cut force in or blade exposure may be set too low if it's not producing a clean cut or if it's cutting all the way through the media it could be set too high.

**Fix:** If the plotter is not producing a clean cut, this can be fixed by either; increasing the cut force in *DLF CM* while decreasing the blade exposure until the unit provides satisfactory results or you can also decrease the cut force and increase the blade exposure until it produces a perfect cut. Adjust both accordingly until the correct cut setting has been achieved.

I the plotter is cutting through the media, this can be fixed by decreasing both the cut force and blade exposure to factory settings and start by increasing the cut force until you get a clean cut. You may have to increase the blade exposure while decreasing the cut force there's a clean cut and the correct settings is has been achieved.

(\*\*NOTE\*\*You can continue to increase the blade exposure i necessary, but remember that when you increase the blade exposure, do not simultaneously increase the cut orce or you will cut through the cutting mat below the media. It is always best to increase one setting while decreasing the other or just increasing one setting only, normally the blade. Never increase both settings simultaneously)

## Plotter error "E01019 Hardware Y Position Alarm Power off then on"



**Problem:** The plotter displays an error *"E01019 Hardware Y Position Alarm Power off then on".* 

**Cause:** This error occurs when the blade tray was moved from side to side by the user after loading the media onto the plotter and with the rear plotter lever in the up position.

**Fix:** To fix this error, you must first power off the plotter, turn the plotter back on, wait for the display on the plotter to load, then press the number "2" as instructed on the plotter to complete the set-up.

### Plotter error "E05004 Hardware Realign Push Rollers Confirm"




**Problem:** The plotter displays an error *"E05004 Hardware Realign Push Rollers Confirm"* 

**Cause:** This error occurs when the pinch rollers are not aligned properly with the plotter's grips.

**Fix:** Before feeding the material through the plotter (While the rear lever is in the down position) be sure that the pinch rollers are aligned properly with the plotter's grips.

### Cutting Manager error "Black-mark not found"

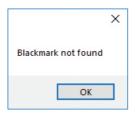

**Problem:** After starting a job in *DLF CM*, you get an error *"Black-mark not found".* 


**Cause:** This problem occurs when after you start the job and the software can't detect the black-mark on the media. The reason for this could be the following; the media is

missing a marker to begin with; the media is not aligned with

the arrows points labeled on the front and back of the plotter; the plotter's camera is not positioned correctly; and the plotter's camera is picking up too much exposure from the sunlight or another light source.

**Fix:** To fix this, before you start any job in *DLF CM* be sure to always do the following; check and make sure the media has a black-mark printed on it to begin with; manually aligned the media with the arrows points labeled on the front and back of the plotter (*This is done with the plotter's rear handle in the down position*); make sure to position the plotter's camera over the blackmark in order to centered marker as much as possible on the software camera preview.

# <u>The Media or Lamination roll might be finished, please check it. Proceed with cutting?</u>

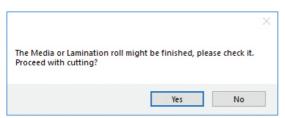

**Problem:** Yellow and Green light simultaneously on lamination control board.

**Cause:** When both the yellow and green LEDs on lamination control panel are on, it would indicate that either the media or lamination sensor have picked up and error or the sensors may be out of sync and needs to be calibrated.

**Fix:** To fix this, please refer to the "Yellow and Green LED's simultaneously on lamination control board" guide above to resolve.

Error: load the media	×
	Error: load the media
	Retry Cancel

Cause: You launched the Cutting Manager while the plotter's lever was down.

**Fix:** Rise the lever on the plotter, than press the button 2 on control panel and wait until the display will show "READY" as status. Then press retry on the popup window.

	×
Dongle not found	1
Retry	Cancel

**Cause:** the software has been opened while the dongle (the red key) was not plugged to the internal hub or the usb from the virgo was not plugged to the pc.

Fix: Plug the dongle to the hub, or reseat the USB cable to the pc and click retry.

Dongle not found

	×
Can't load sensors	
Abort Retry	Ignore

Cause: Media/Lamination sensors might be not plugged in correctly or turned off.

**Fix:** Check if sensors are powered up and plugged correctly into the black sensor box. Then Retry. If you do not want to keep activated the sensors, click Ignore.

### Error: plotter not found

	×
Error: plotter not	found
Retry	Cancel

Cause: The plotter might be switched off or not properly connected.

Fix: Make sure the plotter is turned on and properly connected.


In case it is turned off, please turn the plotter on and than press the button 2 on control panel and wait until the display will show "READY" as status. Then press retry on the popup window.

Last	job	not	fou	nd

	×
Last job not found	
ОК	

**Cause:** You will get this error when you try to open the last job when you run Cutting Manager for the first time after the installation.

Fix: Choose your file through "Open PDF".

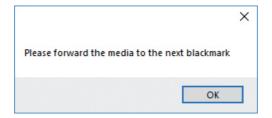

**Cause:** The starting Y position of the cut is a negative value (you can see coordinates on plotter's display when you move the media with arrows). **Keep in mind also the offset influences the starting position of the cut. So, if you start the cut at Y coordinates 0, while you have an offset Y value of -10, you will still get this error. This error might happens when the media has been just loaded.** 

**Fix:** Move to the next black-mark. If it is not enough, forward until you have reached Y coordinate value major than 0.

### <u>Please forward the media to reach a positive Y value shown on the plotter's</u> <u>display</u>



**Cause:** The starting Y position of the cut is a negative value (you can see coordinates on plotter's display when you move the media with arrows).

This error might happens when the media has been just loaded.

**Fix:** Move forward until you have reached positive Y coordinates.

### Error after opening a .pdf file

Cause: - The antivirus doesn't allow the software to open the file

- The file is loaded from a server web or a remote disk. This may create issues sometimes
- The file is not properly built
- Fix: Add the cutting manager to your antivirus's whitelist
  - Move your file to your computer
  - The cutting file must contain only:
  - The contours lines
  - The Black-Mark, in case of Black-Mark mode cutting

### Processing the cut job had issues, or error after opening a .pdf file

ERROR		×
Processing the c	ut job had issue:	
	ОК	

Make sure that:

1- The cut file contains *JUST VECTORIAL LINES AND NOT ANY FILLED FIGURE*, and has been built properly (*pag.17*)

2- The cut file is opened from a pc folder, and not any usb or external network folder.

- 3- Add the cutting manager to your antivirus's whitelist.
- 4- Use just standard occidental letters or numbers for the file nam

## E02001 GPGL Error 1 command error!



Make sure that:

1- The cut file contains JUST VECTORIAL LINES AND NOT ANY FILLED FIGURE, and has been built properly (*check pag.17*)

2- The cut file is opened from a pc folder, and not any usb or external network folder

### If this doesn't solve, restore and init the plotter (pag.19)